




N 34626

Left Right

AMERICAN PROPELLER SERVICE

 AMERITECH INDUSTRIES, INC.

Redding Municipal Airport

Redding, California 96002, U.S.A.

PHONE NUMBER (916) 221-4470/221-4521

FAA REPAIR STATION 412-24

PROPELLER LOGBOOK

PROPELLER MAINTENANCE RECORD

Propeller Manufacturer: McCAULEY

Left Engine Right Engine Front Engine Rear Engine

Hub Model No. B2D34C208

Hub Serial No. 731178

Blade Model No. BODA-6

Blade Serial No. 1 B31150

No. 2 B33419

No. 3 _____

No. 4 _____

No. 5 _____

PITCH RANGE

Low 12.1 High 26.0 Feather _____ Reverse _____

Pitch _____

Governor Manufacturer: _____

Governor Model No. _____

Governor Serial No. _____

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE

AMERICAN PROPELLER SERVICE

Repair Station No. 412-24

Redding Municipal Airport, Redding, California, U.S.A.

Work accomplished _____

COMPLETE OVERHAUL: Propeller disassembled, cleaned, metric and dye penetrant inspected all parts and blades. Blades ground, balanced, alodined, painted and detailed. Propeller assembled, balanced and functionally tested.

Complied with all A.D.'s and Service Bulletins as of this date.

The aircraft and/or component identified above was repaired in accordance with current Federal Aviation regulations and was found airworthy for return to service. Pertinent details are on file at this agency under

Invoice No. 8469

Dated August 22, 1985

Signed _____

[Handwritten Signature]
Authorized Individual

SERVICEABLE PART

Part Name McCAULEY
Hub Mod. No. B2D34C208
Hub Ser. No. 731178
Blade Mod. No. 82DA-6
Blade Ser. No. B31150
B33419

Date August 22, 1985

Governor Mod. No.

Governor Ser. No.

Remarks


AMERICAN PROPELLER SERVICE

A Division of Ameritech Industries, Inc.

Redding Municipal Airport
Redding, California 96002, U.S.A.



**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
<p>AMERICAN PROPELLER SERVICE Repair Station No. 412-24 Redding Municipal Airport, Redding, California, U.S.A.</p> <p>Work accomplished <u>Governor has been COMPLETELY OVERHAULED</u> <u>and functionally tested.</u> <u>RPM set 2295 HIGH, 1100 LOW. *</u></p> <p>The aircraft and/or component identified above was repaired in accordance with current Federal Aviation regulations and was found airworthy for return to service. Pertinent details are on file at this agency under</p> <p>Invoice No. <u>8470-G</u> Dated <u>August 23, 1985</u></p> <p>Signed <u></u> Authorized Individual</p>			

SERVICEABLE PART

Part Name McCAULEY

Date August 23, 1985

Hub Mod. No. _____

Governor Mod. No. C290D2D/T12

Hub Ser. No. _____

Governor Ser. No. 730355

Blade Mod. No. _____

Remarks _____

Blade Ser. No. _____

AMERICAN PROPELLER SERVICE

A Division of Ameritech Industries, Inc.

Redding Municipal Airport
Redding, California 96002, U.S.A.

(916) 221-4470

FORM #301



**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
8/25/85	1187.4	This OVERHAULED PROP & GOV INSTALLED ON N34626 CESSNA 177B THIS DATE	DATA SHEET IN FILE Gerald F. Robertson AIP 1015598
11/15/86	1264:4	#1 Blade Sanded & repainted by American Propeller Ser. due to scratches on lead face. also repainted tips.	Gerald F. Robertson AIP 1015598
11/19/87	1315.1	hrs. SANDED & PAINTED BLADE FACES. CHECKED BACKING PLATE & SPINNER. GOV OPERATION ON THIS DATE.	Gerald F. Robertson AIP 1015598

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
9-20-85			
		<p>Vibration Analysis and Dynamic Balancing of Propeller/Engine/Spinner Combination.</p>	
		<p><u>Original .5 I.P.S.</u></p>	
		<p><u>Final .025 I.P.S.</u></p>	
		<p><u>Gregory D. Souders 9-20-85</u></p>	
		<p>Signature Date</p>	
		<p>By: AMERICAN PROPELLER SERVICE, INC.</p>	
		<p>Repair Station #412-24</p>	
11/12/91	1552.6 hrs	PROP INSPECTED FOR	Gerald F. Robertson
		NICKS & GENERAL CONDITION.	A&P 1015598
		OPERATION OK THIS DATE.	

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
10/26/93	1600.0 hrs	Prop, hub, Blades, Spinner & Backing Plate Inspected for Condition & Security. Blades Serviced & Tips Painted.	G. F. Robertson ATP 1015598
12/3/98	1702.0 hrs	Prop hub, BLADES, SPINNER & BACKING PLATE INSPECT FOR CONDITION & SECURITY, BLADES SERVICED & CLEANED UP ON LEADING EDGES.	G. F. Robertson ATP 1015398
12-3-98	1702.0 hrs.	Researched AD 91-15-04. AD Does not apply due to model # verified by American Propeller (Redding Ca) & AD read-out.	G. F. R ATP 1015598

DATE

11-6-98

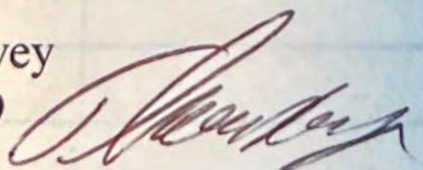
**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
11-6-99	1708.4 hrs	Researched AD 91-15-04 - AD does not apply due to Model # - verified by American Propeller (Redding Ca) Serviced prop blades & painted faces. Visual inspection OK this date. Guild P Robertson A & P 1015598	

**Date: 12-18-03 Tach: 1964.2 Reg. No.: N34626
Model: B2D34C208/82PA-6 S/N: 731178 SPOH: 000.0
PROPELLER INSTALLATION**

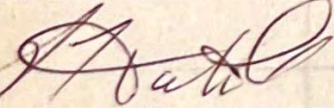
Completed installation of overhauled McCauley propeller (Precision Propeller W.O. 14612, dated 12-08-03). Functional and leak checks satisfactory. END.

Thomas E. Harvey
A&P524088369



**Firewall Forward, Inc.
Loveland, CO 80538**

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
DOG BONE LLC 540 W. AIRPORT CASA GRANDE, AZ. 85222			
N34626 McCauley 2 FEB 06	MODEL: B2D34C208 TACH: 2157.3	S/N: 731178 TSMOH: 193.1	
Preformed an annual inspection All AD's checked thru bi weekly 2006-02 I certify that this propeller has been inspected in accordance with an Annual Inspection, In accordance with FAR part 43, Appendix D, and appropriate manufacturers maintenance Manuals and determined to be in an airworthy condition at this time.			
 STEPHEN HARTWELL A&P527582083IA			

**DOG BONE LLC
540 W. AIRPORT
CASA GRANDE, AZ. 85222**

ON OF ALL OPERATIONS
AIRWORTHINESS DIRECTIVES,
SERVICE LETTERS,
& MINOR ADJUSTMENTS

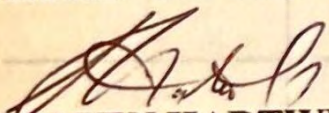
**N34626 McCauley MODEL: B2D34C208 S/N: 731178
5 Apr 08 TACH: 2322.3 TSMOH: 358.1**

SIGNATURE

Performed an annual inspection

All AD's checked thru bi weekly 2008-06, see AD list in rear of log book

**I certify that this propeller has been inspected in accordance with an Annual Inspection,
In accordance with FAR part 43, Appendix D, and appropriate manufacturers maintenance
Manuals and determined to be in an airworthy condition at this time.**


STEPHEN HARTWELL A&P527582083IA

**DOG BONE LLC
540 W. AIRPORT
CASA GRANDE, AZ. 85222**

**N34626 McCauley MODEL: B2D34C208 S/N: 731178
21 Apr 10 TACH: 2474.2 TSMOH: 510.0**

**Performed an annual inspection of propeller, Dressed and painted aft. side of prop
All AD's checked thru bi weekly 2010-07, see AD list in rear of log book**

**I certify that this propeller has been inspected in accordance with an Annual Inspection,
In accordance with FAR part 43, Appendix D, and appropriate manufacturers maintenance
Manuals and determined to be in an airworthy condition at this time.**


STEPHEN HARTWELL A&P527582083IA



Repair Station #: W6NR985J

June 14, 2022

SIGNATURE

Manufacturer: McCauley
Part/Model number: B2D34C208
Work Order No: PST9098

TSN/TSO: 2,979.80 / 1,015.60
Serial Number: 731178
Date: 06/14/2022

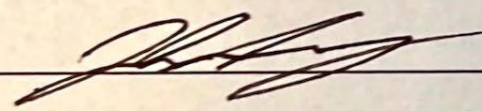
CSN/CSO: N/A / N/A

Squawk

- 1.1 COMPLIED WITH ANNUAL, 50 HR AND 100 HR INSPECTION IAW CESSNA 177 MM, SECTION 2.
- 1.2 COMPLIED WITH 200 HR INSPECTION ITEMS IAW CESSNA 177 SERVICE MANUAL, SECTION 2.

All Work Performed I.A.W. Cessna 177B Appropriate Data.

These items identified above were repaired and/or inspected in accordance with current Federal Aviation Regulations and the repairs are approved for return to service. Pertinent details of these repairs are on file at the repair station under Work Order Number PST9098.

Signature 
For Winner Aviation Repair Station #W6NR985J

Manufacturer: McCauley
Part/Model number: B2D34C208
Work Order No: PST9520

TSN/TSO: N/A / 1,064.60
Serial Number: 731178
Date: 06/02/2023

CSN/CSO: N/A / N/A

Squawk

- 1.1 COMPLIED WITH ANNUAL, 50 HR AND 100 HR INSPECTIONS IAW CESSNA 177 SERVICE MANUAL, SECTION 2. NO DEFECTS NOTED AT THIS TIME.

All Work Performed I.A.W. Cessna 177B Appropriate Data.

These items identified above were repaired and/or inspected in accordance with current Federal Aviation Regulations and the repairs are approved for return to service. Pertinent details of these repairs are on file at the repair station under Work Order Number PST9520.

Signature 
For Winner Aviation Repair Station #W6NR985J

AD# Effective	Subject	Date & Hours @ Comp.	Method Of Compliance	O	R	Next Comp@ Hrs/Date	Authorized Signature & Number
70-04-01 02/20/70	PROPELLER MID-BLADE AND TIP/	1 Mar 07	N/A by model	X		N/A	A&P527582083IA <i>[Signature]</i>
82-27-02 R1 02/22/83	PROPELLER BLADE/	1 Mar 07	N/A by A/C model	X		N/A	A&P527582083IA <i>[Signature]</i>
91-15-04 08/07/91	THREADED RETENTION HUBS/	1 Mar 07	N/A by model	X		N/A	A&P527582083IA <i>[Signature]</i>
03-13-17 07/18/03	MAINTENANCE REPAIR BY T AND W PROPELLERS, INC./	1 Mar 07	N/A by T & W not used	X		N/A	A&P527582083IA <i>[Signature]</i>
05-14-11 08/17/05	MAINTENANCE AND REPAIR BY SOUTHERN CALIFORNIA PROPELLER SERVICE/	1 Mar 07	N/A by Southern California Services not used	X		N/A	A&P527582083IA <i>[Signature]</i>
06-24-07 01/03/07	INSPECTIONS AND REPAIRS BY CSE AVIATION/	1 Mar 07	N/A by CES services not used	X		N/A	A&P527582083IA <i>[Signature]</i>

PRODUCTS DIVISION