




*The Standard*

# ENGINE LOG

431-872

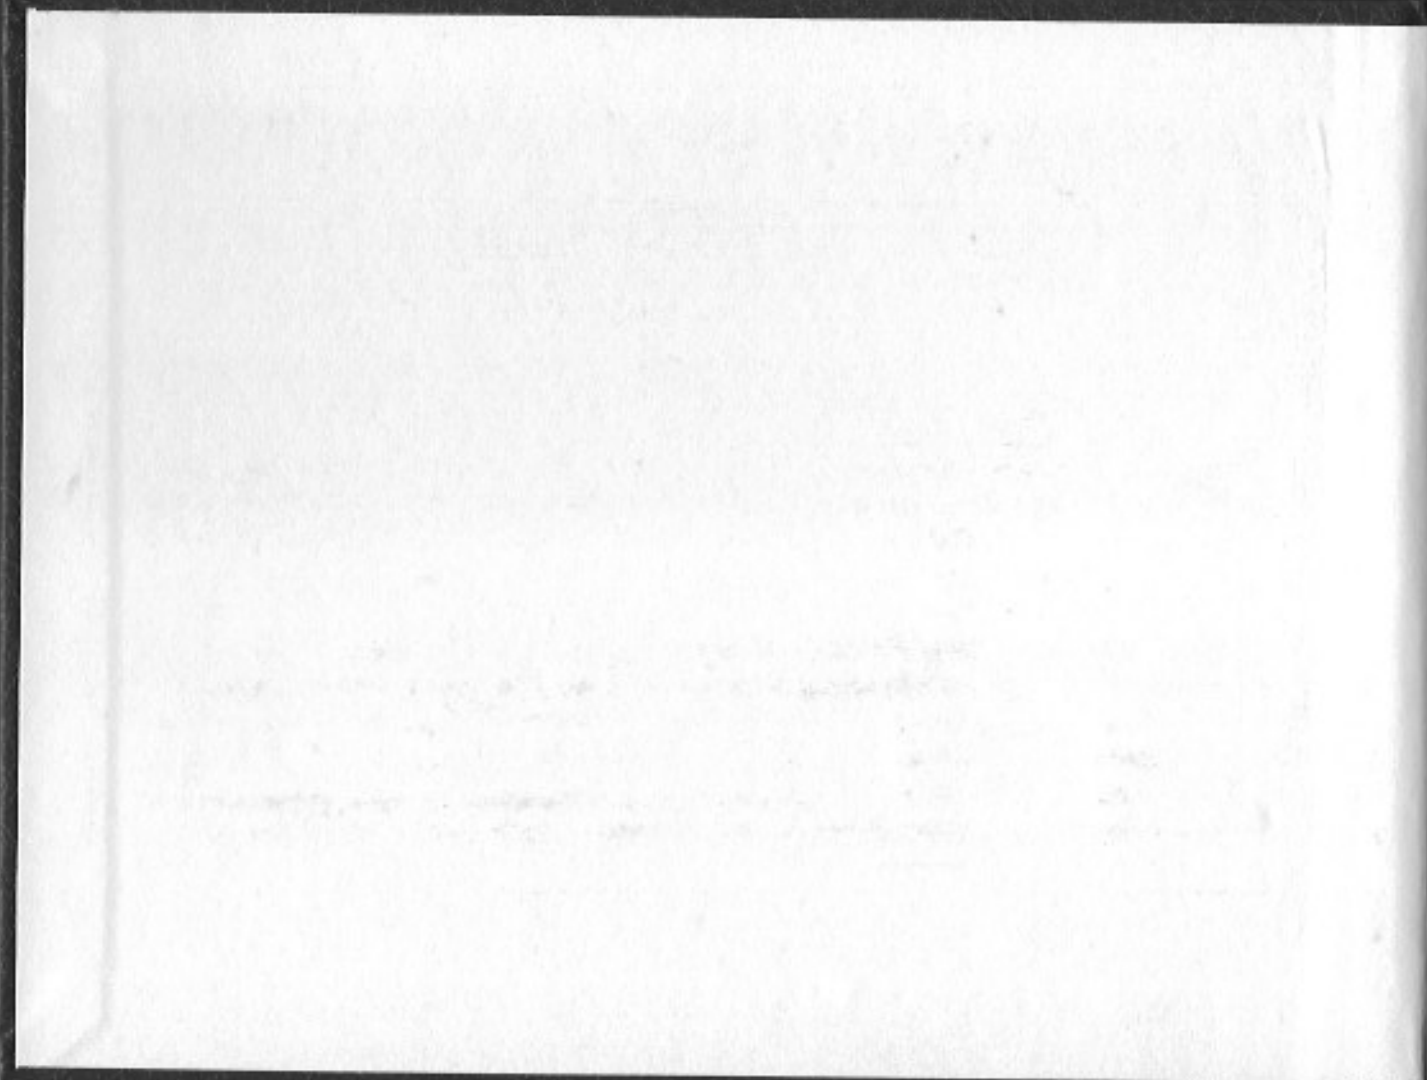

## Tim's Aircraft Engines Inc.

6105 Obispo Ave. Long Beach, Ca. 90805 Ph.#(562) 634-6120  
FAA REPAIR STATION T22R537Y


### Warranty Summary

Tim's Aircraft Engines Inc. will guarantee its workmanship on overhauled engines for a period of (12) months or (500) hours of operation, which ever occurs first, from date of first operation or (3) months from engine sign off date which ever occurs first. All parts and accessories will be covered under the Original Manufacturer's Warranty. Normal maintenance not covered.

All warranty claims must be approved by Tim's Aircraft Engines Inc. Prior to commencing repairs. All warranty parts and labor to be supplied by Tim's Aircraft Engines Inc. unless approved by Tim's Aircraft Engines Inc. Loss of use or down time of aircraft is not covered and will not be considered or compensated. Freight and transportation are not covered. Warranty void if engine is not maintained and operated per factory recommendations. New cylinders and Accessories are subject to Manufacturer's or vender's warranty which may be less than or greater than (12) months. END-----


Book #3

2022 -



The Standard™

**ENGINE LOG**

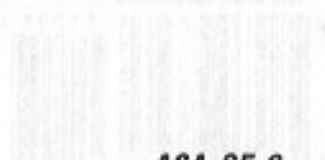

**ASA-SE-2**

**Engine Record** General InformationManufacturer LYCOMING Model O360-A1FGDSerial L-22906-36A Type Certificate -This engine is currently installed in aircraft: N700PJ

Minimum Octane Fuel \_\_\_\_\_ Oil Grade Summer \_\_\_\_\_ Winter \_\_\_\_\_

Magneto Time \_\_\_\_\_ Point Setting \_\_\_\_\_ Firing Order \_\_\_\_\_

Spark Plug Gap \_\_\_\_\_

Manufacturer's Recommended Overhaul at \_\_\_\_\_ hours



YEAR 20 _____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	<b>Description of Inspections, Tests, Repairs and Alterations</b> <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)</small>
--------------------------	---------------------------	-------------------	-----------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

MAKE: Lycoming  
 MODEL: O-360-A1F6D  
 SERIAL # L-22906-36A

N # N709PJ  
 T.T. 2536.6 2607.0

The engine identified above was Overhauled. This engine was disassembled, cleaned, inspected, repaired as necessary, assembled for a Major Overhaul. All work performed with reference to Lycoming O/H Manual 60294-7-14 Rev. Date July 2011 and Parts Manual PC306-1. AD list in back of log book. All pertinent details are on file at this facility under Inv. 12341. Engine was test ran in engine test cell. End.-----

DATE: Sept. 27, 2022

SIGNED: *Tim Maher*  
 FAA REPAIR STATION T22R537Y

TIM'S AIRCRAFT ENGINES INC.  
 6105 OBISPO AVE.  
 LONG BEACH, CA. 90805  
 PH. # (562) 634-6120  
 FAX (532) 634-6129

ations  
ber of  
entries.)

YEAR	TIM'S AIRCRAFT ENGINES INC. FAA REPAIR STATION #T22R537Y						ions
NO	9/27/2022		O-360-A1F6D		L-22906-36A		R/O 12341
DATE	QTY	PART #	DESCRIPTION	QTY	PART #	DESCRIPTION	r of ries.)
	4	01K28983	BUSHING	2	SL13841	CUSHION	
	1	05S21021	SPRING	1	SL18840	CAMSHAFT	
	1	06B23072	GASKET	4	SL36006W-A20P	CYLINDER	
	1	10-682555-11R	DUAL MAGNETO	16	SL383-B	NUT	
	1	149-NL	STARTER	1	SL53E19600	VERN. VALVE	
	2	14W21696	ROLLER	1	SL61084	SPRING	
	2	18A26093	BEARING	4	SL69603	HOSE	
	4	18D26096	BEARING	8	SL71907A	WASHER	
	8	18M26105	BEARING	8	SL72877	HYD. BODY	
	1	23D26777	PLUNGER	4	SL73810	BUSHING	
	1	55K21022	SPACER	8	SL74637	BUSHING	
	8	72198	PLUG	3	SL75061	ROD BOLT	
	2	72797	ROLLER	1	SL78121	SHAFT	
	1	AA48103-2	OIL FILTER	1	STD-1221	RING	
	1	AF15472	FUEL PUMP	3	STD-2249	NUT	
	1	AN8-14A	BOLT	6	URHM38E	SPARK PLUG	
	2	KA10-400574	CAPACITOR	1	AEL68759	TUBE	
	4	LW-14078	PISTON PIN	1	SL68760	TUBE	
	1	10-821414-8	HARNES	2	SL68761	TUBE	
	8	MS16625-3093-C50	SNAP RING	2	SL75330	BAFFLE	
	4	SL-STD-1821	HOSE	3	SL78220	BOLT	
	18	SL-STD-2090	NUT	1	AEL76220	BOLT	
	1	SL1028-B	BALL	2	STD-2291	CLIP	
	8	SL12186	NUT	3	LW-15592-5-05	CLAMP	
	1	SL12945	GASKET	2	66M19365	CLAMP	

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	<b>Description of Inspections, Tests, Repairs and Alterations</b>
------------------------	---------------------------	-------------------	-----------------------------	-------------------------------------------------------------------

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

**COASTAL VALLEY**  
*Aviation Inc.*

(805)928-7701 • www.cvamtx.com


ENGINE  
DATE: 11/08/2022  
N700PJ

Tach: 2607.0  
TTE: 4631.8

Lycoming O-360A1F6D SN L-22906-36A

1. Installed this engine on Cessna 177B, SN 17702628
2. Serviced with 7 qts. Aeroshell 100 Mineral oil

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.

  
Richard Holder A&P 3340719 IA

**COASTAL VALLEY**  
*Aviation Inc.*


(805)928-7701 • www.cvamtx.com

ENGINE  
DATE: 11/30/2022  
N700PJ

Tach: 2617.6  
TTE: 4642.4

Lycoming O-360A1F6D SN L-22906-36A

1. Changed oil, serviced w/7 qts. Aeroshell W100
2. Replaced oil filter with new AA48103-2

  
Richard Holder A&P 3340719 IA

ations  
ber of  
entries.)


YEAR	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
20				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE				

**COASTAL VALLEY**  
*Aviation Inc.*

(805)928-7701 • www.cvamx.com

Lycoming O-360A1F6D SN L-22906-36A

1. Changed oil, serviced w/7 qts. Aeroshell W100 plus
2. Replaced oil filter with new AA48103-2

  
Richard Holder A&P 3340719 1A

ENGINE

DATE: 05/17/2023

N700FJ

Tach: 2653.4

TTE: 4678.2

