


BOOK NO. 1

1

PROPELLER LOG BOOK
Compliments of

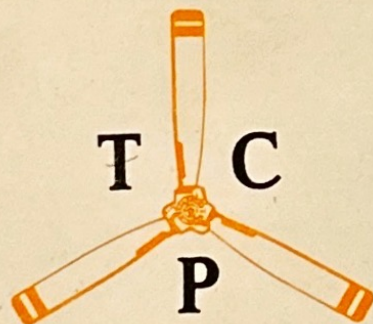

TRI COUNTY PROPELLERS INC.

Tri County Airport • Erie, Colorado 80516 • (303) 665-7905
Repair Station Certificate No. S03-70

PROPELLER MAINTENANCE RECORD

Hub Model B2D34C207

Blade Design 78TCA-0

Diameter 76.76" (76.5" minimum)

Hub Ser. No. 765394

Blade Ser. Nos. _____

No. 1 K60419

No. 2 K60420

No. 3 _____

PITCH RANGE

High 27.5 Low 12.9

Feather _____ Reverse _____

Governor Model _____

DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|----------|-----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------|
| 02-05-90 | | Overhauled propeller and reconditioned blades per McCoway service manual 780630. Complied with all service letters through 1987-6 and service bulletins through 172. No ADs currently apply. AD 82-27-02R1 DNA per sln. TBO is 1500 hours or 5 years. W.O.# 9366. Blades are close to min. width... avoid stone damage. | |
| | | FAA Repair Station S03-70 | <i>[Signature]</i> PR 2349185 |

DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|---------|-----------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|
| 2/8/90 | 1632.1 | This Propeller Reinstated on Cessna 177RG N35127. | |
| 30th | "0" | Run up & ops checked th. | <i>[Signature]</i> Charles P. Craig |
| | | ARAPAHOE AERO INC HGR 14 12850 E. CONT. TOWER RD. ENGLEWOOD, CO 80112 | A4P1391958 |
| 2/11/91 | 1752.0 | Hobbs Time 1874.3 TT 1752.0: I certify this Propeller has been inspected in accordance with an annual inspection in accordance with the Manufacturer Specifications and was determined to be in an airworthy condition. | <i>[Signature]</i> END |
| | | | IA 128486729 |

DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|---------|----------------|------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------|
| 6-20-91 | 1787 | Repacked governor by Palmer Bead propeller (see tag) and reattached replace cable bracket | |
| 3-13-92 | 1854.5 | I CERTIFY THAT THIS PROPELLER WAS INSPECTED IAW AN ANNUAL INSP. AND FOUND TO BE IN AIRWORTHY CONDITION | WILLIAM M. SIMMONS #A2188952TX |
| 4-5-93 | T.F. 1872.6 | I CERTIFY THAT THIS PROPELLER WAS INSPECTED IAW AN ANNUAL INSPECTION AND DETERMINED TO BE IN AIRWORTHY CONDITION | H.H. ELLIS TRCA. SCHOOL CRS # 0J1R168K William M. Simmons |

DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|--------|-----------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------|
| 5-9-94 | 1933.2 | T.I. 1933.2 T.S.O.H 301.1 DRESSED AND PAINTED BLACK FACES. I CERTIFY THAT THIS PROPELLER HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION | WILLIAM M. SIMMONS 1A1475560 |

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|--------|-----------|----------------------------------------------------------------------------------------------------------------------------------------------------|-----------|
| 6-9-95 | TACH 2010 | FOOTHILL AIRCRAFT SALES & SERVICE, INC. CABLE AIRPORT, UPLAND, CALIFORNIA 91786 FAA APPROVED REPAIR STATION AJ4R052M | |
| | T.T. 2010 | PROP. OVERHAUL + PAINT | |
| | | INSPECTED IN ACCORDANCE WITH <u>ANNUAL</u> INSP. AND APPROVED FOR RETURN TO SERVICE OTHER DETAILS OF THIS INSPECTION ARE ON FILE AT THIS FACILITY. | |
| | | DATE 6-21-96 | |
| | | NAME <u>Roger R. Colby</u> | |
| | | W.O. NO. <u>1588</u> DATE <u>7-1-97</u> | |
| | | TAC <u>2129</u> T.T. A/C <u>2139</u> ENG <u>2159</u> | |
| | | NAME <u>[Signature]</u> | |

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|--------|-----------|----------------------------------------------------------------------------------------------------------------------------------------------------|-----------|
| 7-1-97 | TACH 2139 | FOOTHILL AIRCRAFT SALES & SERVICE, INC. CABLE AIRPORT, UPLAND, CALIFORNIA 91786 FAA APPROVED REPAIR STATION AJ4R052M | |
| | T.T. 2139 | PROP. OVERHAUL + PAINT | |
| | | INSPECTED IN ACCORDANCE WITH <u>ANNUAL</u> INSP. AND APPROVED FOR RETURN TO SERVICE OTHER DETAILS OF THIS INSPECTION ARE ON FILE AT THIS FACILITY. | |
| | | DATE 7-20-98 | |
| | | NAME <u>Michael A. Schulz</u> | |
| | | W.O. NO. <u>2481</u> DATE <u>7/20/98</u> | |
| | | TAC <u>2196-3</u> T.T. A/C <u>2196-3</u> ENG <u>2196-3</u> | |
| | | NAME <u>Michael A. Schulz</u> | |

DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|----------|-----------|------------------------------------------------------------------------------------------------------------------------------------------------|--------------------|
| 10/15/01 | | COMPLETELY OVERHAULED I.A.W McCAULEY MANUAL # <u>780650</u> ALL S.B., S.L. AND A.D.'S COMPLIED WITH TO DATE <u>10/15/01</u> W.O. 295d | |
| | | A.D = NONE | |
| | | S.B = 103, 106, 119A, 172 B, 172A & 227B. | |
| | | S.L = 78-3, 79-4, 79-5, 79-7, 80-7, 81-7, 85-3, 86-4, 87-3, 91-2, 98-5, 98-12, 98-15, 98-22c, 99-9, 2000-3, 7 | |
| | | 2000-7A. | <i>[Signature]</i> |
| | | T & W PROPELLERS INC. 7000 Merrill Ave Bldg E3 #50 Box #62 Chino, CA 91710 FAA Repair Station T6WR776N | 70WR776N |

DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

| DATE | TACH TIME | DESCRIPTION OF WORK | SIGNATURE |
|--------|-----------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------|
| 1-9-02 | 2385 | Prop INSTALLED AFTER O/H Prop TIME IS "0" AFTER O/H. | |
| | | FOOTHILL AIRCRAFT SALES & SERVICE, INC. CABLE AIRPORT - UPLAND, CALIF. 91786 FAA APPROVED REPAIR STATION AJ4R052M WO# <u>5527</u> DATE <u>1-9-02</u> C <u>2385</u> NAME <u>[Signature]</u> | |

