

MID FLORIDA AIRCRAFT PROPELLER, INC.

N29LK  
CESSNA 177RG

# PROPELLER LOGBOOK

PROPELLER MODEL B2D34C207 / 78TCA

PROPELLER S/N 751719

LOGBOOK# \_\_\_\_\_

EAST COAST PROPELLER SERVICE, INC.  
 2079 Main Street  
 Lititz, PA 17543  
 717-627-7407 800-875-6377  
 REPAIR STATION #B65R064Y  
 " Safety Through Quality "

DUNKIRK AVIATION  
 3389 MIDDLE RD

Acct: 260

Workorder: ER-5751  
 Date: 10/10/06  
 Terms: Net 0  
 P.O.:

DUNKIRK, NY 14048

KIRBY McCALL 716-366-6938

TAC: 1215 TT: 1215

MCCAULEY

B2D34C207/78TCA-0-

S/N 751719

MAJOR OVERHAUL. BLADES REFINISHED. PARTS ZYGLOED, MAGNAFLUXED, REPLATED. PARTS REPLACED WHERE REQUIRED. COMPLIED WITH AD'S AND SB'S LISTED ON THE YELLOW TAG. TRACKED, BALANCED, PAINTED, SET ANGLES.

REMOVAL & INSTALLATION OVERHAUL LABOR	\$1,100.00	CADIUM PLATING	\$100.00
INSPECT & REPAIR AS NECESSARY BLADE STRAIGHTENING BLADE REWORK		SHOTPEENING HUB REWORK DEICER BOOT INSTALL OUTSIDE LABOR	
		TOTAL LABOR	\$1,200.00
1 NP	NORMAL PARTS	\$495.00	\$495.00
1 C5263	CYLINDER	\$375.00	\$375.00
2 A3902	LINK	\$44.70	\$89.40
		TOTAL PARTS	\$959.40
ECPS DELIVER		TRANSPORTATION	
		SUBTOTAL	\$2,159.40
		CORE CHARGE	
		DISCOUNT LABOR	\$120.00
		DISCOUNT PARTS	\$76.75
			\$0.00
	SALES TAX/RESALE #NO		
		TOTAL AMOUNT DUE	\$1,962.65

OCT 17 2006

*M*

*[Signature]*

DKK

Date	Propeller TSN TSO		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
				742 1377
				TS 1377
				5449 162



### Aircraft Engineering, Inc.

Bldg. 434 Bartow Airport  
Bartow Florida 33830  
863.533.1870 FAA VF4R594M

#### ANNUAL STATEMENT

Date 10/2/09 SMOH 122  
TAC 1337 Total Time 1337  
I certify that this PROPELLER has been inspected in accordance with an ANNUAL inspection and has been determined to be in airworthy condition.  
AD'S thru Card 2009-19 AD list back of log book. For details work order # 9938  
Bill Turley Signature [Signature] #VF4R594M Inspector Rating



### Aircraft Engineering, Inc.

Bldg. 434 Bartow Airport  
Bartow Florida 33830  
863.533.1870 FAA VF4R594M

#### ANNUAL STATEMENT

Date 9/13/10 SMOH 162  
TAC 1377 Total Time 1377  
I certify that this PROPELLER has been inspected in accordance with an ANNUAL inspection and has been determined to be in airworthy condition.  
AD'S thru Card 2010-19 AD list back of log book. For details work order # A91027  
Bill Turley Signature [Signature] #VF4R594M Inspector Rating

TAC	1430
TT	1430
SMOH	215



## Aircraft Engineering, Inc.

Bldg. 434 Bartow Airport  
 Bartow Florida 33830  
 863.533.1870 IA #2104727

### ANNUAL STATEMENT

**N29LK**

Date	<u>3/17/2016</u>	SMOH	<u>215</u>
TACH	<u>1430</u>	Total Time	<u>1430</u>

I certify that this Propeller has been inspected in accordance with an Annual inspection and has been determined to be in airworthy condition.

AD'S checked thru CD 2016-05. AD list on file

For details see work order #A 21629

Bill Turley Signature Inspection Authorization #2104727



THE OHIO STATE UNIVERSITY  
 AIRPORT  
 2160 West Case road  
 Columbus, Ohio 43235-2526  
 CRS# IKBRO28F

Date: 2/27/17      Work Order#: AMO7501      N#: N29LK  
 Aircraft Make/Model: Cessna / 177RG      Serial#: 177RG0736  
 Propeller Make/Model: McCauley / B2D34C207      Serial#: 751719  
 Tach. Time: 1454.8      Propeller TSMOH: 246.8      Propeller TT: 1454.8

### Propeller Log:

- Complied with an Propeller 100hr Inspection using Cessna 177RG AMM chap. 2 Inspection Guide Revision 3 dated 7/1/1995 and other current data.

I certify that this Propeller has been inspected in accordance with 100 hour inspection and was determined to be in airworthy condition. All applicable A.D.'s checked thru 2017-03

### "Maintenance Release"

The aircraft and/or component identified above was repaired and inspected in accordance with current Federal Aviation Regulations and was found airworthy for return to service. Pertinent details of the repair are on file at this agency.

END

Signature: *[Handwritten Signature]* for CRS# IKBRO28F





**Aero Precision Unlimited**  
1075 Pittsburgh Dr.  
Delaware Ohio 43015  
9372090962

**Make:** McCauley  
**Model:** B2D34C Series  
**Tail:** N29LK  
**S/N:** 751719

**Hours:** PTT:1660.2 PTSMOH:425.2 Tach:1660.2

Performed annual inspection I/A/W FAR 43.13 Appendix "D", Cessna 100 series MM D991-13: Revision - 3, Revision Date - Sep 1, 1974 Section 2., McCauley B2D34C series overhaul / maintenance manual.

Removed spinner, checked for cracking, nothing noted at this time

Inspected propeller blades and shanks at hub, nothing noted at this time

Inspected spinner back plate for cracking or any other abnormalities, nothing noted at this time.

Owner advised of propeller calendar time

Performed a post maintenance run up / leak check / ops check, all "OK" at this time.

All AD's current and C/W as of Small Aircraft, FAA Bi-Weekly 2022-06, 02/28/2022 - 03/13/2022

I certify this aircraft has been inspected in accordance with an annual inspection and is in airworthy condition at this time.

Jeffrey Guy A&P 2147901 I/A

**Signed:**

**Name:** Joseph Rambosek

**Cert:** AP 3761674

**Date:** 03/18/2022

Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.

Hrs



**Aero Precision Unlimited**  
1075 Pittsburgh Dr.  
Delaware Ohio 43015  
9372090962

**Make:** McCauley

**Model:** B2D34C207

**Tail:** N29LK

**S/N:** 751719

**Hours:** Tach Time: 1677.6

Removed McCauley Propeller PN: B2D34C207 SN: 751719.

Sent to H&S Propeller Shop Inc. for Overhaul.

Reinstalled McCauley Propeller PN: B2D34C207 SN: 751719 after overhaul. Torqued bolts to 55 ft-lbs in accordance with McCauley B2D34C Series Overhaul/Maintenance Manual and safety wired. Post Maintenance Runup and Ops check Satisfactory at this time.

**Signed:**

*Joseph B. Rambosek*

**Name:**

Joseph Rambosek

**Cert:** AP 3761674

**Date:** 07/22/2022



907 Aviation LLC.  
1075 Pittsburgh Dr.  
Delaware Ohio 43015  
9372090962

Make: McCauley  
Model: B2D34C207  
Tail: N29LK  
S/N: 751719

Hours: TT: 1698.5 PropTT: 1698.5 PTSMOH: 20.9


Performed annual inspection I/AW FAR 43.13 Appendix "D", Cessna 100 series MM D991-13: Revision - 3, Revision Date - Sep 1, 1974 Section 2., McCauley B2D34C series overhaul / maintenance manual (MPC26)  
Removed spinner, checked for cracking, nothing noted at this time  
Inspected propeller blades and shanks at hub, nothing noted at this time  
Inspected spinner back plate for cracking or any other abnormalities, nothing noted at this time.  
Propeller dynamically balanced to .10 IPS @ 190 degrees  
Performed a post maintenance run up / leak check / ops check, all "OK" at this time.  
All AD's current and C/W as of Small Aircraft, FAA Biweekly 2023-14, 06/19/2023 - 07/02/2023  
I certify this propeller has been inspected in accordance with an annual inspection and is in airworthy condition at this time.

Jeffrey Guy A&P 2147901 I/A

Signed: \_\_\_\_\_  
Name: Joseph Rambosek

Cert: AP 3761674  
Date: 07/15/2023



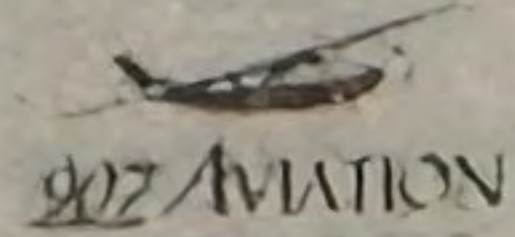

907 Aviation LLC.  
1075 Pittsburgh Dr.  
Delaware, Ohio 43015

**Make:** McCauley

**Model:** B2D34C207

**Tail:** N29LK

**S/N:** 751719

**Hours:** Tach: 1779.9 TTP: 1779.9, TSMOH: 102.1

Performed annual inspection I/AW FAR 43.13 Appendix "D", Cessna 100 series MM D991-13: Revision - 3, Revision Date - Sep 1, 1974 Section 2., McCauley B2D34C series overhaul / maintenance manual (MPC26)

Removed spinner, checked for cracking, nothing noted at this time

Inspected propeller blades and shanks at hub, nothing noted at this time

Inspected spinner back plate for cracking or any other abnormalities, nothing noted at this time.

Performed a post maintenance run up / leak check / ops check, all "OK" at this time.

All AD's current and C/W as of Small Aircraft, FAA Biweekly 2025-07 03/24/2025-04/06/2025

I certify this propeller has been inspected in accordance with an annual inspection and is in airworthy condition at this time.

**Signed:**

Joseph B. Rambosek

**Name:**

Joseph Rambosek

**Cert:**

AP 3761674 IA

**Date:**

04/07/2025