


**AIRCRAFT
MAINTENANCE RECORDS**

N 53073

**AIRFRAME
LOG BOOK**

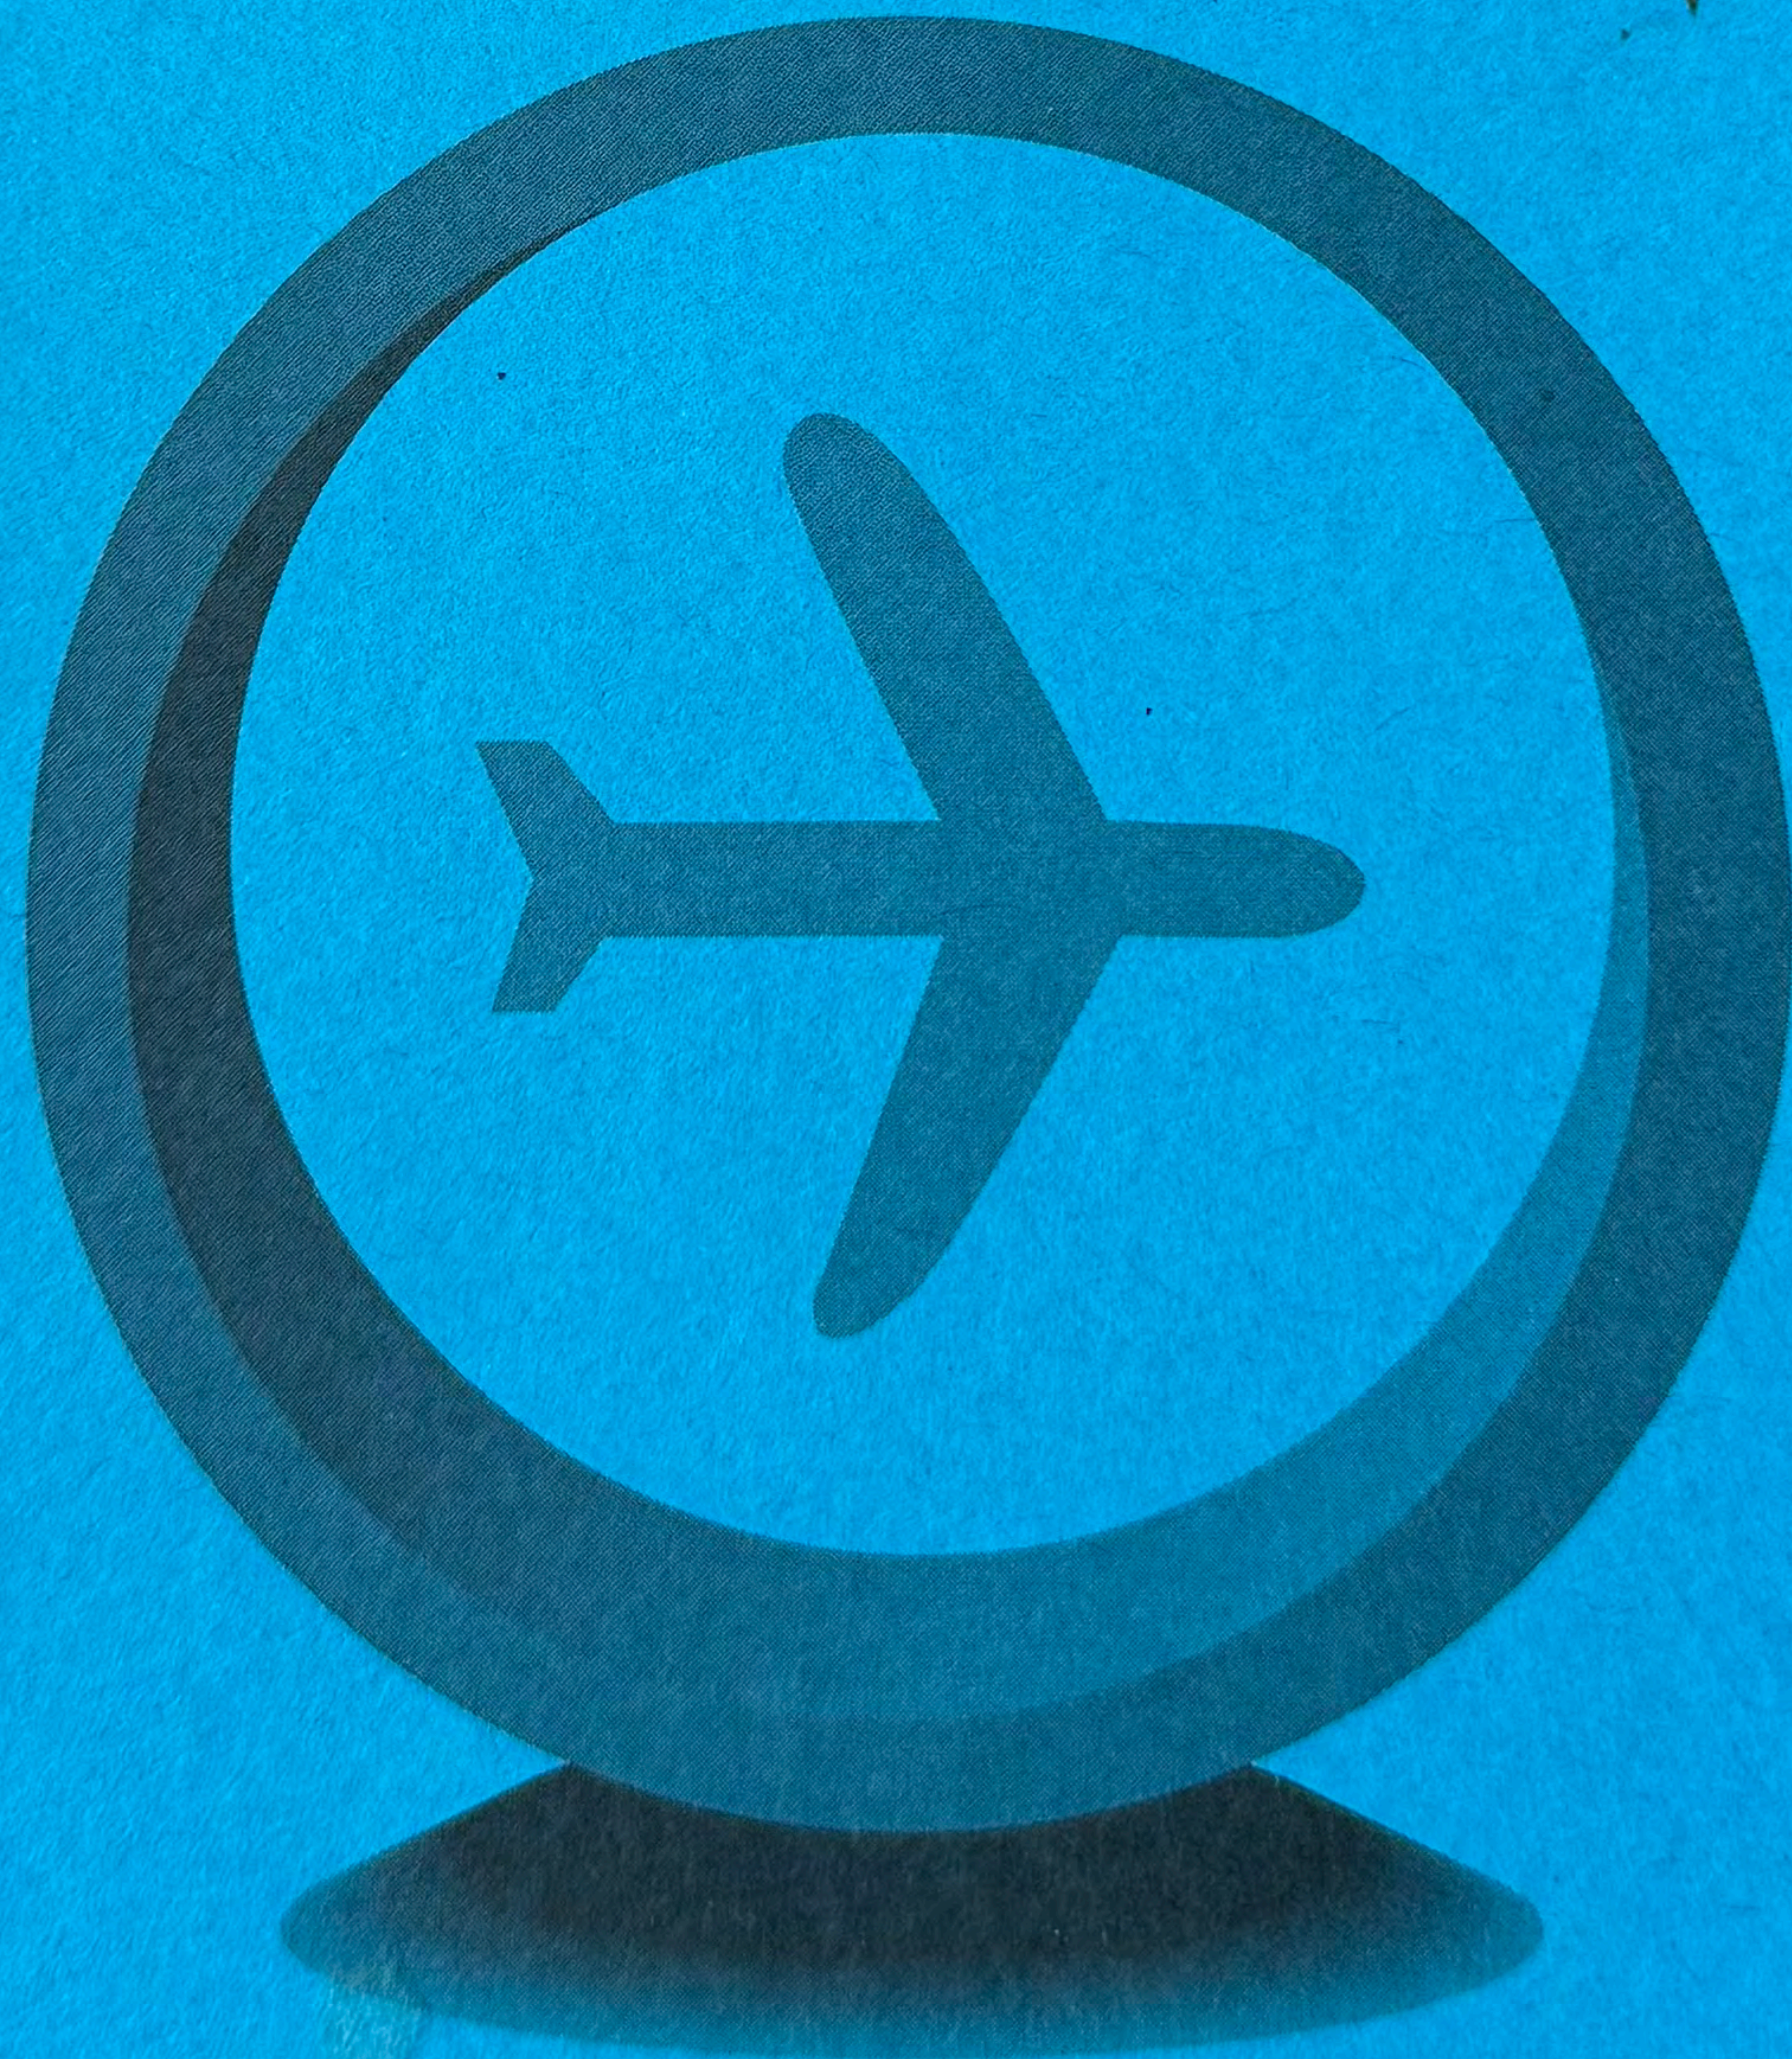

AIRCRAFT MAINTENANCE RECORD Page No. _____



RELIABLE JET MAINTENANCE, LLC.
3900 AIRPORT RD. HANGAR 1, BOCA RATON, FL 33431

561-417-3834

Date:	September 22, 2020	Registration:	N53073
Work Order:	20-19740	Aircraft S/N:	177RG-1337
Aircraft Total Time:	4500	Aircraft Total Cycles:	100

AIRFRAME LOG ENTRY

Performed the following Maintenance:

1. Charged and installed Mainship Battery {p/n: G-242 s/n: G03071304}. Operational checks good with no defects noted. Work done with reference to GILL TBP 1560 Rev I.
2. Gained access and removed windshield and installed a new windshield {p/n: LP-329-250-GT} with new hardware: 6ea new screws {p/n: MS24693S28} with 6ea new self-locking nuts {p/n: MS21044N06}. Work done with reference to STC SA00382NY, LP Aero Plastics, Inc. Heavy Gauge, and Installation Drawing List: Report No. 329 / CON, Dated: 3/16/95.
3. Removed #6 vent line, fabricated a new line with new B-nut {p/n: AN818-6D} and new ferrel {p/n: AN819-6D}. work done with reference AC43.13 1B/2B.
4. Removed corrosion on the wing through the spar per SEL-57-09. Eddy current inspection done per NDT Solutions Inc. Work Order #37009.
5. Rewired Alternator IAW Textron 177RG Maintenance Manual Chapter 16-9. Operational check good with no other defects to note.
6. Flushed fuel system and sumped wings per Textron 177RG Maintenance Manual Pages 11-16.
7. Replaced all cockpit/cabin overhead fresh air scat tubing with 16 feet of new Scat8 duct. Reinstalled cockpit overhead trim as required.

The airframe described in Work Order# 20-19740 is certified airworthy and approved for return to service for work performed 14 CFR 43.9 (a)(4) and in accordance with current Federal Aviation Regulations.

Chris Rukavina
For
Reliable Jet Maintenance, LLC. CRS# LCPR025G
Created By: UL



3689 Industrial Park Drive,
Marianna, FL, 32423
<https://nevilleaviation.com>



3689 Industrial Park Drive,
Marianna, FL, 32423
<https://nevilleaviation.com>

07 Nov 2022 0266.1 Tach.

N53073

C/W AD 2011-10-09 by inspection (para (g)), next due 07 Nov 2023 or 0266.1 Tach.

Lee Munshower
AP167666230

14 Nov 2022 0266.1 Tach.

N53073

Installed NLG steering bungee P/N 2060003-1 IAW Cessna SM.

Lee Munshower

AP167666230

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date

CARRIED FORWARD →



DESCRIPTION OF WORK PERFORMED
PERSON PERFORMING WORK

3689 Industrial Park Drive,
Marianna, FL, 32423
<https://nevilleaviation.com>

14 Nov 2022 0266.1 Tach.

N53073

This aircraft has been inspected and has been found safe for the intended flight IAW Special Flight Permit dated 07 Nov 2022 from KBCR to KMAI.

Lee Munshower

AP167666230



3689 Industrial Park Drive,
Marianna, FL, 32423
<https://nevilleaviation.com>

15 Apr 2023 Tach. 0266.6

N53073

Found previous damage repairs due to a gear up landing, Repairs made by James J Fleming of Best Aviation, Inc. 6213 Boynton Beach, FL 33437. Repairs appear to have been completed October 2020 at 0 Found lower fuselage center, outer skins and bulkheads replaced between FS 88.00 and FS 122.00, part numbers: 2011000-7, 2012020-5, 2012020-13, 2012068-1, 2011020-1, 2011018-3, 2011019-1. All 4 seat tracks and floors located above replaced components were removed and reinstalled to facilitate repairs. After inspection, all repairs appear to be C/W IAW Cessna Cardinal series service manual section 17 (structural repair) and AC 43.13-1B chapter 4.

Lee Munshower

AP167666230



3689 Industrial Park Drive,
Marianna, FL, 32423
<https://nevilleaviation.com>

21 Apr 2023 Tach. 0266.6

N53073

Performed 100 hour/Annual inspection I.A.W. 43.13 app D. AD's checked thru this date. AD 2023-02-17 C/W by SEL-57-09, C/W on 09/03/2020 see WO# 37009 from RS# N56R026B and c/w ON 09/22/2020 WO# 20-19740 from CRS# LCPR025G. AD's 2011-10-09 and 72-03-03 R3 C/W due at next annual or 100 HOURS, see AD list for full compliance. ELT checked IAW FAR 91.207, Battery due Jul 2023.

I certify that this airframe has been inspected IAW an Annual inspection and found to be in an airworthy condition.

Lee Munshower

AP167666230IA

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

CARRIED FORWARD →

Date: 6-1-2023

Altimeter System Tests performed to comply with CFR 91.411 and CFR 43 Appendix E has been tested to

20,500 Feet for N53073

Make/Model: United 5931P-A56

Serial Number: 86227

Work Order # 1920

Authorized Signature Herbert Meyer

Great American Barnstormers Inc.
7824 Skyhawk Road
Pace, FL 32571
FAA CRS# N9OR246Y

I Certify this ATC Transponder

Model GTX 327

S/N 43750147

as installed in this aircraft N53073 has been tested as required by CFR 91.413 and meets the requirements of CFR 43 Appendix F for operation.

Work Order# 1920

Great American Barnstormers Inc.
7824 Skyhawk Road
Pace, FL 32571
FAA CRS# N9OR246Y

Authorized Signature Herbert Meyer

Date: 6-1-2023

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE